

<b>Subject:</b>  <b>AIR TEMPERATURE WILL NOT CHANGE</b>	<b>Bulletin No:</b> 07-003/15
	<b>Last Issued:</b> 11/17/2015

## BULLETIN NOTE

- This bulletin supersedes the previous bulletin 07-003/15 issued on 02/04/15. The APPLICABLE MODEL(S)/VINS has been revised.
- Changes are noted below in Red beside the change bar.

## APPLICABLE MODEL(S)/VINS

2014-15 Mazda3 (Japan built with manual A/C) with VINS lower than JM1BM\*\*\*\*\*247593 (produced before December 1, 2014)

2014-15 Mazda3 (Mexico built with manual A/C) with VINS lower than 3MZBM\*\*\*\*\*182009 (produced before January 1, 2015)


## DESCRIPTION

Some customers may complain about that air temperature from the air conditioner will not change by the air temperature control knob, and may be accompanied by some rattle noise from inside of the dash board. This concern may be caused by the temperature control link being pulled out of the HVAC housing. To correct the problem, the temperature control link has been modified.


Customers having this concern should have their vehicle repaired using the following repair procedure.

## REPAIR PROCEDURE

1. Verify customer concern.
2. Refer to the instructions on MS3 online or the Workshop Manual (section 07-40 CLIMATE CONTROL UNIT REMOVAL/INSTALLATION [MANUAL AIR CONDITIONER]) and check that the MIX LINK (Air mix link/Temperature control link) (A) is properly connected to the MIX DOOR CRANK (B) and works while rotating the temperature control knob.

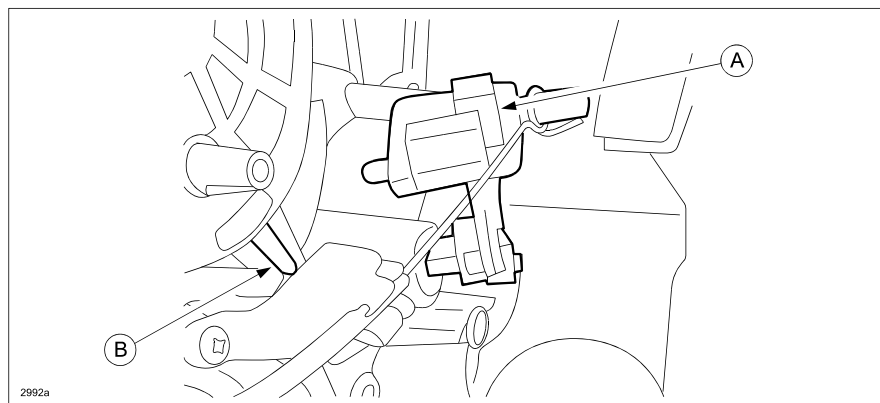

- a. If it works, this Service Bulletin does not apply. Refer to the instructions on MS3 online or Workshop Manual for troubleshooting and repair.
  - b. If the MIX LINK is detached, proceed to the next step.
3. Replace the MIX LINK with a modified one. Refer to MS3 online or the Workshop Manual (section 07-11 A/ C UNIT DISASSEMBLY/ASSEMBLY). Make sure that the MIX LINK is fitted in the groove of the MIX DOOR CRANK and will not come out with movement.

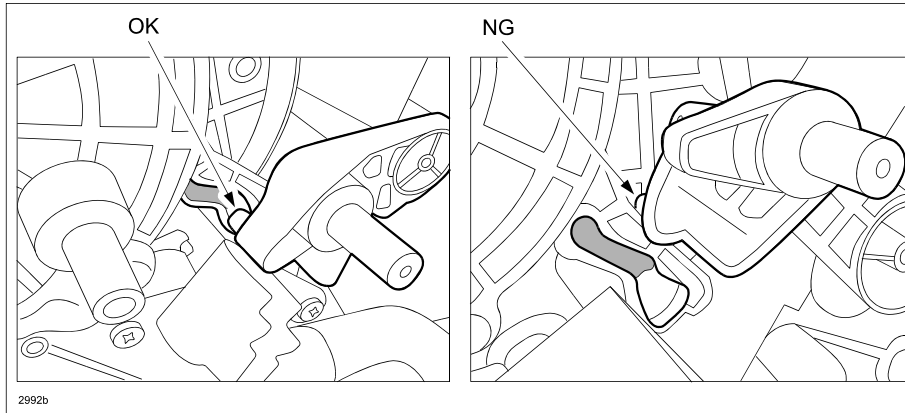

4. Install the parts in the reverse order.
5. Verify repair.

## PART(S) INFORMATION

Part Number	Description	Qty.	Notes
BHS2-61-A20A	Link Set, Temp1	1	Japan built vehicles (JM1)
BKA4-61-A20	Link Set, Temp1	1	Mexico built vehicles (3MZ)

**NOTE:** BHS2-61-A20A is compatible to BKA4-61-A20 and may be used on Mexico built vehicles.

## WARRANTY INFORMATION

**NOTE:**

- This warranty information applies only to verified customer complaints on vehicles eligible for warranty repair.
- This repair will be covered under Mazda's New Vehicle Limited Warranty.
- Additional diagnostic time cannot be claimed for this repair.

Warranty Type	A
Symptom Code	60
Damage Code	9E
Part Number Main Cause / Qty.	BHS2-61-A20A or BKA4-61-A20 / 1
Operation Number / Labor Hours:	XXKBXARX / 0.2 Hrs.